

Date: Monday, 2/27/2006 4:16:02 PM
User: Kim Johnston

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B
Job Number	: 25957A		
Estimate Number	: 10163		
P.O. Number	: N/A	Part Number	: D206642241
This Issue	: 2/27/2006	S.O. No.	: N/A
Prsht Rev.	: NC	Drawing Number	: D2650 REV D1
First Issue	: N/A	Project Number	: N/A
Previous Run	: 25956A	Drawing Revision	: D1
		Material	: N/A
Written By	: <i>See comment below</i>	Due Date	: 3/20/2006
Checked & Approved By	: <i>JA 06-02-28 n</i>	Qty:	1 Um: Each
Comment	: Est Rev:M 04.12.02 .Revised procedural steps KJ/JLM		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	D2620	Bent 206 Skidtube
-----	-------	-------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
-----	-------------	-------------	-------

1	D2620	Bent Tube 3" OD	B24497
---	-------	-----------------	--------

Pm' 06-04-05 ①

2.0	D32861	Doubler
-----	--------	---------



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
-----	-------------	-------------	-------

2	D3286-1	Doubler	B24206
---	---------	---------	--------

Pm' 06-04-10 ①

3.0	D2647	Cap
-----	-------	-----



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
-----	-------------	-------------	-------

1	D2647	Fwd Cap	D20535
---	-------	---------	--------

Pm' 06-04-05 ①

4.0	LANDING GEAR 1	LANDING GEAR RESOURCE 1
-----	----------------	-------------------------



Comment: LANDING GEAR RESOURCE 1

1-Debur Fwd edge of tube

Pm' 06-04-05 ①

2- Remove ridge on inside of Fwd edge of tube as per Dwg D2650

Pm' 06-04-05 ①

3-Weld Fwd Cap as per Dwg D2650. Use aluminum rod. Grind D2647 to fit as required.

Pick:

Qty	Part Number	Description	Batch
-----	-------------	-------------	-------

W/O:

WORK ORDER CHANGES

DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng Prod Mgr

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:

WORK ORDER NON-CONFORMANCE (NCR)

DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng.	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 2/27/2006 4:16:03 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 25957A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

A/R Aluminum Rod *M18839/m19101 BE 06-04-05 (1)*

4-Grind weld flush to cap on top surface only. *pm 06-04-10 (1)*

5-Cut Aft end as per dwg 2650 from front of tube and Deburr *pm 06-04-10 (1)*

6-Remove inner indexing ridge on Aft end of skidtube as per Dwg D2650 *pm 06-04-10 (1)*

7-Open holes for Aft end cap as per Dwg D2650 with #30 Drill Bit using DT8025. *pm 06-04-10 (1)*

8-Drill pilot holes using Dt 8167. *pm 06-04-10 (1)*

9-Locate DT8732 from inner Aft saddle hole & 3rd crossbolt hole. Insert D3286-1 doubler using DT8732 & D206-642-241-T1, then locating doubler off of 3/16" holes, cleco DT8732 & doubler leaving DT8732 for added support. *pm 06-04-10 (1)*

10- Drill D3286-1 doubler rivet holes in tube using # 40 drill, spot drilling doubler at the same time. *pm 06-04-10 (1)*

11-Working from the center out, drill # 30 holes into D3286-1 doubler. Cleco each hole as it is being drilled. Verify angle of holes to accommodate rivet heads. *pm 06-04-10 (1)*

12-Remove and Deburr D3286-1 doubler. *pm 06-04-10 (1)*

13-Remove 3/16" cleco's only and open GHW holes to Ø0.500" as per Dwg D2650 *pm 06-04-10 (1)*

14-Remove D3286-1 doublers, identify orientation, deburr, then attach them to the workorder *pm 06-04-10 (1)*

15-Remove indexing edge using DT8741 as per Dwg D2650. *pm 06-04-10 (1)*

16-C'sink GHW rivet holes as per Dwg D2650 *pm 06-04-25 (1)*

5.0 QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

6.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open crossbolt holes to Ø0.3125" as per Dwg D2650 *pm 06-05-01*

2-Drill pilot holes using DT8028-3, then open to Ø0.297" as per Dwg D2650. Open Aft cap hole #6. *pm 06-05-01*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: ☒ Date: 06/08/04
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
06-04-12	4	3 holes at the rear location of the 640 holes is ovalized. Gripped crooked when transfer drilling through the stainless doubler.	BE 06-04-12	Fill hole with weld as per Q51004, using a plug on the inside, and grind flush and re-drill as per Dwg.	BE 06-04-18	BE 06-04-12	BE 06-04-12	BE 06-04-12

NOTE: Date & initial all entries

Date: Monday, 2/27/2006 4:16:03 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 25957A

Part Number: D206642241

Job Number: -



Seq. #:

Machine Or Operation:

Description :

3-Deburr tube and blow out chips from inside the tube-

fm 06-05-20

7.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005'4.1

fm 06-05-20

8.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

BE 06-05-09 (1)

9.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open holes to finished size as per Dwg D2650, D2650-3 Drilling Detail (without cutting fluid)

fm 06-05-20

2-C'sink crossbolt spacer holes as per Dwg D2650(without cutting fluid)

fm 06-05-20

3-Deburr and blow out all chips from inside the tube

fm 06-05-20 (1)

10.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

BE 06-05-09 (1)

11.0

CR3212404

Cherry Rivet



Comment: Qty.: 52.0000 Each(s)/Unit Total : 52.0000 Each(s)

Pick:

Qty Part Number Description Batch

52 CR3212-4-04 Rivet

M100218 fm 06-05-20 (32)

12.0

D26543

206 I-Beam (Web)



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2654-3

Web

B26865 fm 06-05-20 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: 0 Date: _____

QA: N/C Closed: 2 Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 2/27/2006 4:16:03 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 25957A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Locate, install and rivet doublers as per Dwg D2650. Micro-shave rivets as required

pm 06-05-90

2-Bond D2654-3 web in place as per QSI 015. Ensure holes line up. Allow 12 Hrs. cure time before cutting

Start Date: *06-08-9* Time: *1:30pm*

Finish Date: *06-05-10* Time: *2:00pm*

Pick:

Qty Part Number Description Batch

A/R Sikaflex-291 *M100901*

Sikaflex expire date: *06-11-01*

pm 06-05-90

14.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Ja 0515

15.0

D2649

Crossbolt Spacer



Comment: Qty.: 18.0000 Each(s)/Unit Total: 18.0000 Each(s)

Pick:

Qty Part Number Description Batch

18 D2649 Crossbolt spacer *324200 (8PCS)*

25864 (10PCS) BE 06-05-15 (1)

16.0

D32863

Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 D3286-3 Spacer *24711 BE 06-05-16 (1)*

17.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Insert D2649 crossbolt spacers. Weld as per QSI 004 and Dwg D2650. Remember to back drill each hole to 0.25" before welding the other side. Use aluminum rod.

Pick:

Qty Part Number Description Batch

A/R Aluminum Rod *M18839 BE 06-05-16 (1)*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 2/27/2006 4:16:03 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 25957A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

2-Grind welds flush as per Dwg D2650.

BE 06-05-16 (1)

3-Using DT8733, insert (2) D3286-3 spacers as per QSI 004 and Dwg D2650. Remember to back drill each hole to Ø0.402" before welding other side. Use SS rod as required.

A/RSS Rod:

NONE BE 06-05-16 (1)

4-Counterbore 5/16" x 0.750" deep except 7th hole from Aft end as per Dwg D2650. Deburr

18.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 CCR264SS3-3 Rivets

m16548 BE 06-05-16 (1)

19.0

M7885343

Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 M7885/3-4-3 Rivets

m19099 BE 06-05-16 (1)

20.0

D2680041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2680-041 Nut Plate

224223 BE 06-05-16 (1)

21.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install D2680-041 Nut Plate as per Dwg D2650

BE 06-05-16 (1)

22.0

QC5/9

WELD INSPECTION



229-9PD 06-05-17

2605-18 (1)

Comment: Inspect weld and Counterbore work to Current Step. Inspect for foreign objects as per QSI 024

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 2/27/2006 4:16:03 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 25957A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

23.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref. 4.3.5.1) as per QSI 005 4.3. Make sure Nut Plate Thread is protected using paint screw, and mask GHW studs.

a.m. 06-07-28

(1)

24.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

RC 06 07 31 (1)

25.0

D26483

Wearpad



Comment: Qty.: 5.0000 Each(s)/Unit Total : 5.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

5 D2648-3

Wearpad

B 25104

26.0

D265613

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-13

Wearshoe

B 27074

27.0

D265621

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-21

Wearshoe

B 20917

28.0

D265633

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-33

Wearshoe

B 21146

a.m. 06-07-31 (1)

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 2/27/2006 4:16:04 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 25957A

Part Number: D206642241

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

29.0 D34291



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number	Description	Batch
1 D3429-1	Wearpad	B 24417

30.0 ALS41032130 Insert



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty Part Number	Description	Batch
44 ALS4-1032-130 Inserts		M 19393

or (see QSI 017)

31.0 AN960JD10L Washer



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty Part Number	Description	Batch
44 AN960JD10L Washer		M 100233

32.0 MS27039108 Screw



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty Part Number	Description	Batch
44 MS27039-1-08 Screw		m 19551

33.0 D26511 Plug



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Pick:

Qty Part Number	Description	Batch
18 D2651-1 Plugs		B 23865

a.m 06-07-21

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 2/27/2006 4:16:04 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 25957A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

34.0

D26513

O-Ring



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Pick:

Qty Part Number Description Batch

18 D2651-3 O-Rings B 25866

35.0

MS27039406

Screw



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 MS27039-4-06 Screw m6974

36.0

AN960JD416

Washer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 AN960JD416 Washer m11151

a.m 06-07-31 (1)

37.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1]

1- Install inserts & wearpads as per dwg D2922. Use a drop of Sikaflex inside insert holes before installing wearpad/wearplate.

A/R Sikaflex-291 m101261

Sikaflex expire date: 02/07

2-Install D2651-3 O-Rings on D2651-1 plugs with Petroleum Jelly and install plugs as per Dwg D2650. Clean excess adhesive.

3-Install MS27039-4-06 Screw as per DEO 9153.

a.m 06-07-31 (1)

38.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Inspect for foreign objects as per QSI 024

DL 06/07/31 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 2/27/2006 4:16:04 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 25957A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

39.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch
1 D2646 Aft Cap B 22587

40.0

MS27039108

Screw



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description Batch
2 MS27039-1-08 Screw M19551

41.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description Batch
2 AN960JD10L Washer M100233

a.m 06-07-31 (1)

42.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install D2646 Aft Cap and seal with Sikaflex. Clean excess adhesive

A/R Sikaflex-291 M101261

Sikaflex expire date: 02-07

a.m 06-07-31 (1)

2-Wing Walk as per Dwg D2650-3 and QSI 005 4.4

Batch: 101667

FC 06 07 31

43.0

QC3/5

INSPECT WORK/WING WALK



Comment: INSPECT WORK/WING WALK

DL 0608101 (1)

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: ☒ Date: 26/08/04
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 2/27/2006 4:16:04 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 25957A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :


44.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL
Inspection Level 21

 06/08/04 ①

Job Completion



C206/08/04

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



DESIGN	CP	DRAWN BY	CP	DART AEROSPACE USA, INC.	
				PORT HADLOCK, WA	
CHECKED	HA	APPROVED	HA	DRAWING NO.	REV. D
				D2650	SHEET 1 OF 5
DATE				TITLE	SCALE
04.05.17				206/407 SKIDTUBE ASSEMBLIES	NTS
A	97.03.25		NEW ISSUE		
B	97.06.26		AS MANUFACTURED CHANGES		
C	97.10.29		CHANGE HOLE PATTERN AND FRONT END		
D	04.05.17		REDRAW; INCORP. DE09136/9153/9163 MOD GROUND HNDLNG ON D2650-1/-3		

RELEASED
04.06.22

Qty -1	Qty -3	Qty -5	Qty -7	Part Number	Description
X				D2650-1	SKIDTUBE ASSEMBLY
	X			D2650-3	SKIDTUBE ASSEMBLY
		X		D2650-5	SKIDTUBE ASSEMBLY
			X	D2650-7	SKIDTUBE ASSEMBLY
1	1	1	1	D2600-1-160	EXTRUSION
1				D2654-1	WEB
	1			D2654-3	WEB
		1		D2654-5	WEB
			1	D2654-7	WEB
1	1	1	1	D2646	AFT CAP
1	1	1	1	D2647	CAP
16	17	19	23	D2649	CROSS BOLT SPACER
16	18	14	22	D2651-1	PLUG
16	18	14	22	D2651-3	O-RING
1	1	1	1	D2680-041	NUT PLATE
2	2			D3286-1	DOUBLER
2	2			D3286-3	STUD
42	44	54	60	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, ALS7-1032-130)
2	2	2	2	AN960JD10L	WASHER
2	2	2	2	CCR264SS3-3	RIVET
2	2	2	2	CR3212-4-03	RIVET
2	2	2	2	MS27039-1-08	SCREW
1	1	1	1	MS27039-4-06	SCREW
1	1	1	1	AN960JD416	WASHER
52	52			CR3212-4-04	RIVET

NOTES

- 1) WELD PER DART QSI 004
- 2) DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- 3) BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015
- 4) INSERT D2651-1 PLUG C/W D2651-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE)
- 5) FINISH: -CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
-POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
-BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 6) DRILL Ø0.297 FOR ALS7-1032-130 INSERTS USING TEMPLATE DT8056-1 ON -1 TUBE, DT8056-3 ON -3 TUBE, DT8056-5 ON -5 TUBE, AND DT8056-7 ON -7 TUBE. INSTALL INSERTS AFTER FINISH.
- 7) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED

SHOP COPY
RETURN TO
ENGINEERING

UNCONTROLLED COPY


SUBJECT TO AMENDMENT
WITHOUT NOTICE


WORK ORDER

NO. 25957A


Copyright © 1997 by DART AEROSPACE USA, INC.

 THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.


COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.		 DART AEROSPACE USA, INC. PORT HADLOCK, MA	
DESIGN CP	DRAWN BY CP	CHECKED H	APPROVED H DRAWING NO. D2650
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.		DATE 04.05.17	TITLE SKIDTUBE
			SCALE 1:10

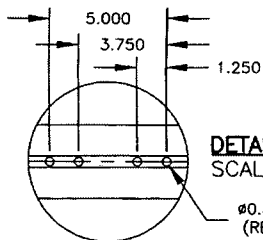

DETAIL A
SCALE 1:5
Ø0.375 (REF)

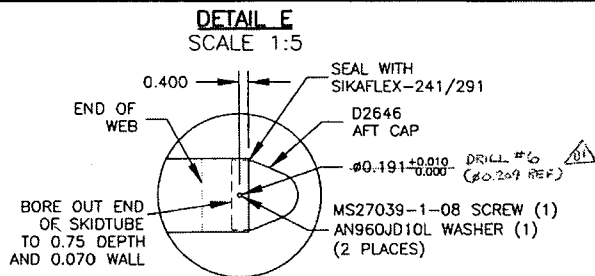


DETAIL E
SCALE 1:5

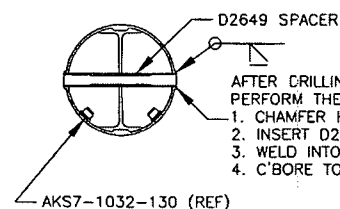


DETAIL D
FOR Ø0.375 HOLES ONLY

- AFTER DRILLING AND BENDING ASSEMBLY PERFORM THE FOLLOWING FOR Ø0.375 HOLES ONLY:
1. CHAMFER HOLE 0.030 X 45°
 2. INSERT D2649 SPACER
 3. WELD INTO PLACE AND GRIND FLUSH
 4. C'BORE TO Ø0.313 X 0.75 DEEP

RELEASED

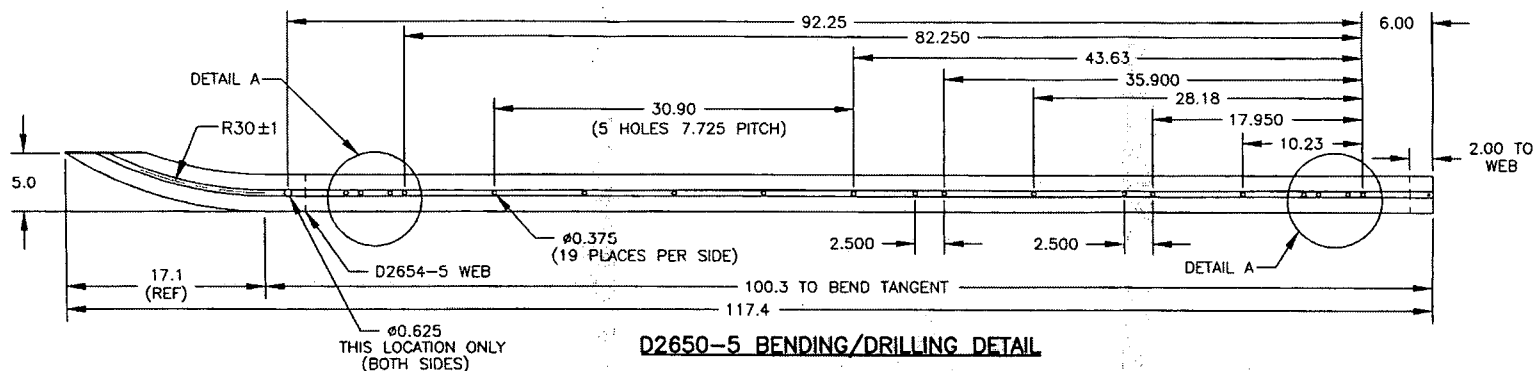

D2650-5 BENDING/DRILLING DETAIL

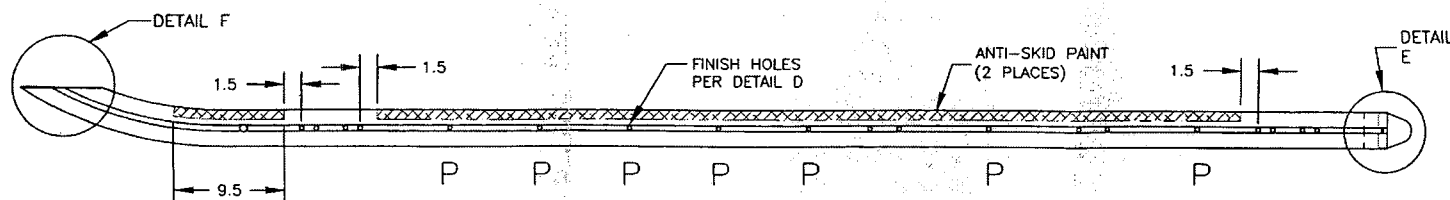


D2650-5 ASSEMBLY/FINISHING DETAIL

DETAIL F (NOT TO SCALE)

1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D2647 (TRIM AS NECESSARY)
4. WELD D2647 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D2680-041 NUT PLATE IN PLACE

 NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH



REMOVE RIDGE ON INSIDE OF SKIDTUBE LEAVE 0.070 MIN.

NO. 2595714
WORK ORDER
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
SHOP COPY
RETURN TO
ENGINEERING

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.		DESIGN	DRAWN BY	DART DART AEROSPACE USA, INC. PORT KENNES, WA	
CHECKED	APPROVED	DATE	04.05.17	DRAWING NO. D2650	REV. D SHEET 4 OF 5
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.				TITLE SKIDTUBE	SCALE 1:10

